
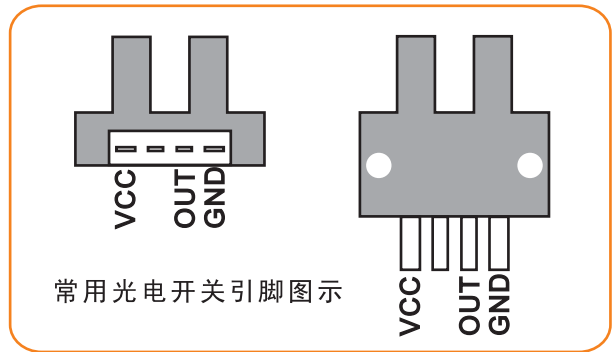
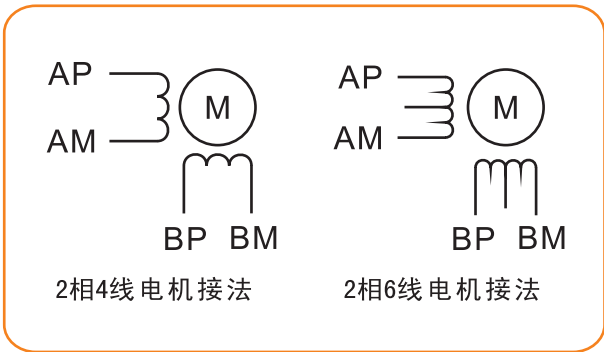


TB6560AHQ 雕刻机驱动板接线说明

Wayhe

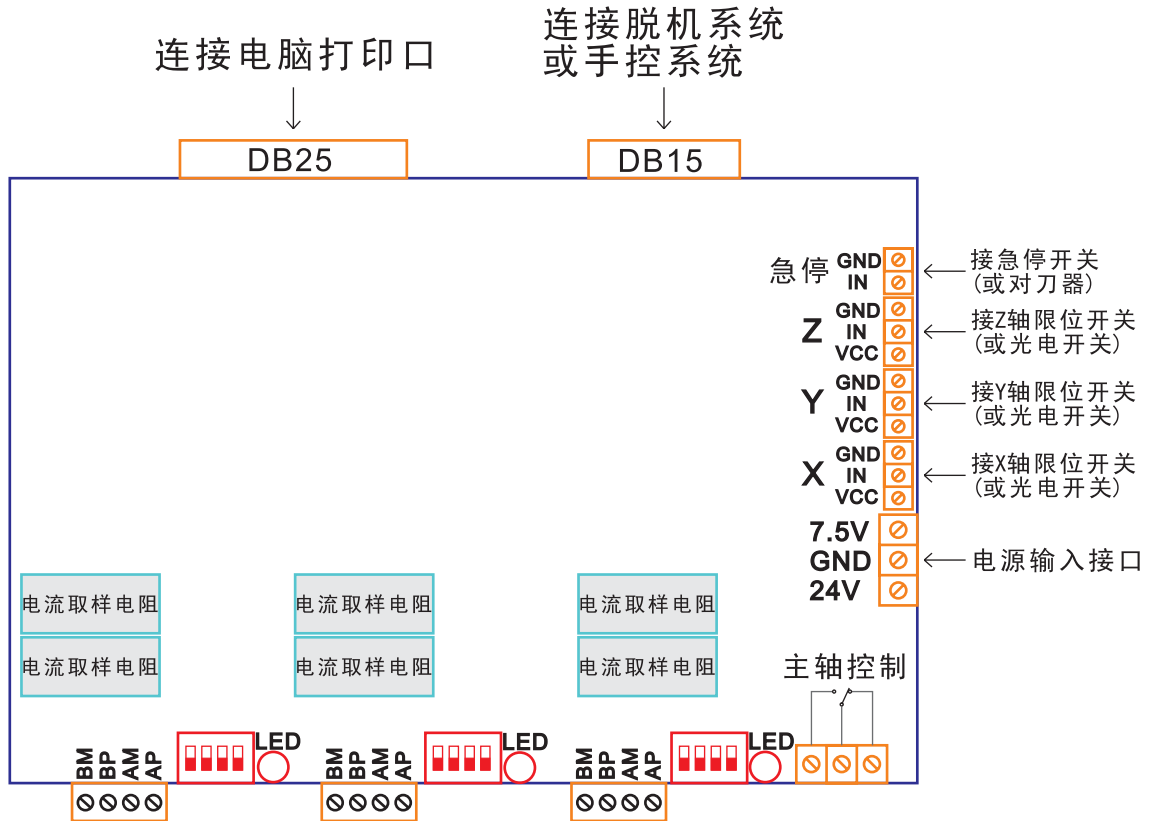

 M2 M1 DCY2 DCY1 NO OFF	M2	M1	细分	DCY2	DCY1	衰减
	NO	NO	2	NO	NO	正常
	NO	OFF	4	NO	OFF	25%
	OFF	NO	16	OFF	NO	50%
	OFF	OFF	8	OFF	OFF	100%